



NARKOMED 6000 TECHNICAL SERVICE BULLETIN # 6012

Product: Narkomed 6000

Date: December 20, 2001

Re: Bag Arm assemblies configured with ventilator leak test adapter not identified by a purple O-Ring under its mounting collar.

Reference Doc: ECN #01-0768

Reason/Rational: The ventilator leak test adapter on certain early shipments of the redesigned Bag Arm assemblies may be out of round. The result may be excessive leakage reported during the performance of a Divan Ventilator Self Test, or Leak and Compliance Tests.
Note: The leak test adapter is not a breathing circuit component when a patient connection is made.

**Solution/
Procedure:** All Bag Arm assemblies configured with a ventilator leak test adapter and identified by a black O-Ring under its mounting collar shall be replaced with the modified design p/n 4114705 identified by a purple O-ring. All Bag Arm assemblies exchanged under this program must be returned to Dräger Medical and require an RMA p/n 4114705 for their return. The exchange of this part must either be documented on the attached report or on NM6K Technical Service Bulletin 6007-C.

NOTE: All 2.06 update kits p/n 4117240 shipped after November 1st 2001 include the modified Bag Arm with purple O-ring. Bag Arms without leak test adapters do not need to be returned to DMI.

Devices affected: 10011-10031, 10033-10038, 10040-10044, 10046-10061, 10063-10139, 10141-10186, 10188-10208, 10210-10213, 10215-10233, 10235-10315, 10318-10362, 10368-10401, 10403-10415, 10417-10455, 10459-10465, 10467, 10470, 10475-10568, 10570-10590, 10592-10598, 10600, 10602, 10605, 10608-10623, 10625-10641, 10644-10651, 10654-10661, 10663-10665, 10667, 10669-10678, 10682-10694, 10696-10744, 10746-10766, 10770-10771, 10775-10781, 10783-10790, 10792, 10793-10798, 10801-10904, 10937-10941

NOTE: All Distributor and Regional Service Managers will be provided with a report identifying the affected customers units in their territory.

Timing/When: If the machine serial number is included in the list of affected devices and still requires 2.06 version updates the modified Bag Arm assembly shall be modified during the installation of the 2.06 update kit.

If the machine serial number is included in the list of affected devices and the machine has received 2.06 version updates using parts shipped prior to November 1st 2001 the bag arm shall be replaced during the next Service Call or Manufacturer's Certification.

Additional Info:

Costs: The modified Bag Arm assembly is available at no charge if this TSB is referenced at the time the order is being placed and the original is returned under RMA.

Ordering Info/Parts: P/N 4114705 BAG ARM ASSEMBLY

Distribution: Draeger Medical Inc. USA – Service; Education, Customer Service, Affected DMI Distributors

If you have any questions, please contact Technical Support by phone at 1-800-543-5047, by fax at 1-215-721-5789, or by E-mail at techsupport@draegermed.com



FIELD CORRECTION REPORT

NARKOMED 6000 BAG ARM TEST PLUG WITH PURPLE O-RING

After each modification is successfully completed or verified as performed previously, a check mark shall be entered in the Completed/Pass box, and initials entered into the TSR initials box. A Technician's signature is required at the completion of each account upgrade. Within 24 hours of completion of the machine's upgrade the report shall be faxed to 215-721-5784, or a copy of this report mailed to:

DrägerService
3122 Commerce Drive
Telford, PA 18969
Attention: Ken Horsfield

Hospital Name: _____

Street Address: _____

City: _____

State & Zip: _____

S/N: _____ S/N: _____ SN: _____ S/N: _____

S/N: _____ S/N: _____ SN: _____ S/N: _____

S/N: _____ S/N: _____ SN: _____ S/N: _____

S/N: _____ S/N: _____ SN: _____ S/N: _____

S/N: _____ S/N: _____ SN: _____ S/N: _____

TECHNICIAN:	I.D. #	DATE:
--------------------	---------------	--------------